2600-FM-BECB0013 Rev. 11/2017
Electronic Version

Pennsylvania
DEPARTMENT OF ENVIRONMENTAL
PROTECTION

COMMONWEALTH OF PENNSYLVANIA DEPARTMENT OF ENVIRONMENTAL PROTECTION BUREAU OF ENVIRONMENTAL CLEANUP AND BROWNFIELDS

NARRATIVE REPORT FORM

Facility Name: Glenwood Drive and Walker Road

Primary Facility ID:881609

Telephone:

Inspection Date: 6-18-25 In	spection Time: 9:30-11:30	1	La	ıt/l ong:			
-	•			Lat/Long:			
Program:ECB Storage	ogram:ECB		HSCA		□ LRP		
Owner Name: Energy Transfer			Inspection ID:		Site ID:		
Facility Location (911) Address: Glenwood Drive, Walker Road, and Spencer Road			Municipality: Upper Makefield Twp.				
Washington Crossing, PA 18977			County: Bucks				
Responsible Official Name: Brad Fish				Responsible Official Address: 100 Green Street			
Title: Senior Environmental Specialist Emergency Response & Remediation				Marcus Hook, PA 19061			
Responsible Official Telephone: 610-859-6297			Interviewee Name:				
Email Address: bradford.fish@energytransfer.com Affiliation:							
			Email Address:				
Narrative:							
Olivia Budnovitch visited the site to oversee this morning measuring and gauging event that is performed on the pre-determine residential potable wells and recovery well RW-1. Zach Podranksy was present for GES who arrived at 9:20am.							
<u>Address</u>	<u>Arrival Time</u>	PID (ppm	<u>D1</u>	Γ <u>P (ft.)</u>	DPW (ft.)	LNAPL thickness (ft.)	
– before bailing	9.42	388.9	2	26.27	26.82	0.55	
– after bailing	-	-	2	27.05	27.07	0.02	
	9:36	0.0		-	25.30	0	
- before bail	ling 10:25	333.4	2	25.15	25.16	0.01	
– after bailin	g -	-		-	25.34	0	
	11:03	0.7		-	42.56	0	
	11:10	0.0		-	25.46	0	
- recovery wel	10:54	21.7		-	28.21	0	
- potable well	10:58	0.0		-	41.69	0	
DTP - Depth to product (LNAPL) DPW - Depth to water							
DEP Representative Name	DEP Representative Signa	EP Representative Signature Olivia Budnovitch		Title Geoscientist		Date: 6-18-25	
Olivia Budnovitch						Telephone: 484-250-5705	
Signature by the person interviewed do person was shown the report or that a	pes not necessarily imply co	ncurrence w	ith the fin	dings on	this report but o	does acknowledge that the	
Interviewee Name	Interviewee Signature		Title		Date:		

Electronic Version

Facility Name: Glenwood Drive and Walker Road Primary Facility ID: 881609

Narrative (continued):
Observations:
The interface probe was properly decontaminated between each use
- PID readings were obtained immediately when the well cap was opened.
- Product samples were collected from the well at
- The homeowner at came outside to observe activities.
: Light odors noticed while the well head was open. The smell was not constant during activities but was sensed in wafts.
: Light odors noticed immediately when the well head was open, which resolved after a few seconds.
When I arrived onsite a crew from GES was there performing pumping of the recovery well network (RW-2 through RW-4). When RW-2 was opened I did not smell any odors.
I spoke with Kevin from GES who was onsite screening the recovery well network on Glenwood Drive with a PID. No elevated PID readings were observed during his screening.
I spoke further with Kevin and the other GES crew about complaints of odors after hours when there is no work being completed or
personnel in the neighborhood. The GES crew explained that the well caps for all recovery wells are always screwed back on tightly
after pumping activities are completed for the day for each well. I inquired about any possible spills or drips that could have occurred in
the last few days and they told me there were no spills or drippage. They also explained that in the event of minimal drippage occurring
during activities, they keep absorbent pads around the open well and mop up the area when they are finished. I did not notice any odors
along the recovery network, or any staining or sheens indicative of petroleum.
I spoke with at a transfer observing gauging and bailing activities. I arrived at a r home at 11:15. had
complaints of odors around RW-2 in the evening of 6/17/25 after work was completed for the day. explained that around 5:45pm was walking the neighborhood and got a waft of petroleum smell while as standing very close to RW-2.
stood there for a few moments and continued to get wafts of the same odor before continuing walk. There was no other activity
going on during this time, including yard work or larger vehicles, etc.
the same location around 8pm that same night also noted that another resident was on a morning walk this morning, 6/18/25 and
complained of an overwhelming petroleum odor around , the home purchased by the Company and the site of recovery
well RW-1. I documented our conversation and left the residence.
I departed from the neighborhood at 11:32.


DEP Representative Name	DEP Representative Signature Title		Date: 6-18-25			
Olivia Budnovitch	Olivia Budnovitch Digitally signed by Olivia Budnovitch	Geoscientist	Telephone: 484-250-5705			
Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that						
the person was shown the report or that a copy was left with the person.						
Interviewee Name	Interviewee Signature	Title	Date:			
			Telephone:			

COMMONWEALTH OF PENNSYLVANIA DEPARTMENT OF ENVIRONMENTAL PROTECTION BUREAU OF ENVIRONMENTAL CLEANUP AND BROWNFIELDS

NARRATIVE REPORT FORM

Facility Name: Glenwood Drive and Walker Road

Primary Facility ID: 881609

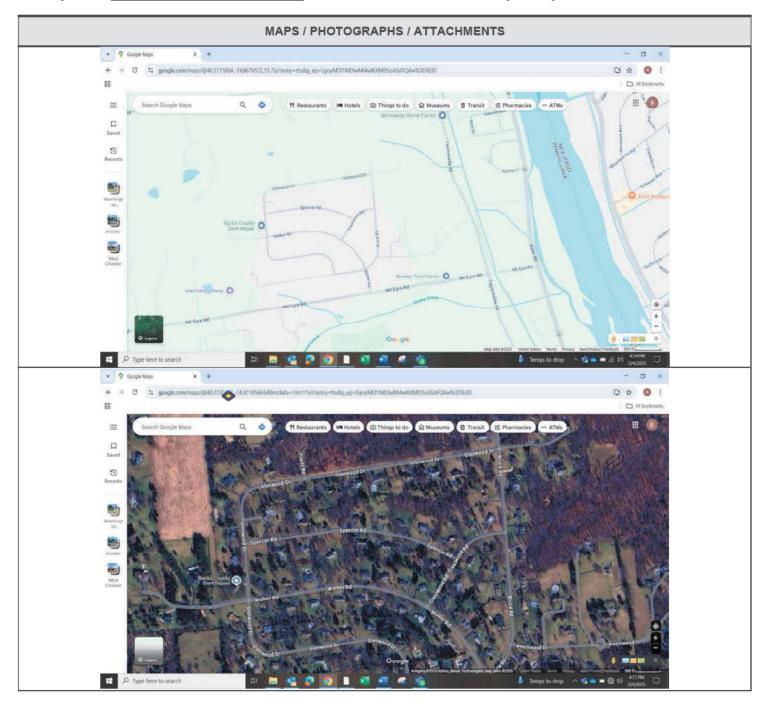

DEP Representative Name	DEP Representative Signature	Title	Date: 6-18-25				
Olivia Budnovitch	Olivia Budnovitch Digitally signed by Olivia Budnovitch	Geoscientist	Telephone: 484-250-5705				
Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.							
Interviewee Name	Interviewee Signature	Title	Date:				
			Telephone:				