



## NARRATIVE REPORT FORM

Facility Name: Glenwood Drive & Walker Road

Primary Facility ID: 881609

Inspection Date: 9/12/25		Inspection Time: 9:45 – 13:45		Lat/Long:	
Program:		<input type="checkbox"/> Storage Tanks		<input type="checkbox"/> HSCA	
				<input checked="" type="checkbox"/> LRP	
Owner Name:			Inspection ID:		Site ID:
Facility Location (911) Address: Spencer Road Washington Crossing, PA 18977				Municipality: Upper Makefield Township	
				County: Bucks County	
Responsible Official Name: Bradford Fish  Title: Senior Environmental Specialist Emergency Response & Remediation				Responsible Official Address: 100 green Street Marcus Hook, PA 19061	
Responsible Official Telephone: 610.859.6297  Email Address:  Bradford.fish@energytransfer.com				Interviewee Name:  Affiliation:  Email Address:	

### Narrative:

The purpose of today's site visit was to observe the installation of monitoring well MW-13D located at the [REDACTED] residence. Entities present at the site included Olivia Budnovitch (DEP), technical staff from Energy Transfer/Sunoco Pipeline, L.P. (SPLP), Groundwater & Environmental Services (GES), Summit Drilling, LLC, and Stantec.

I arrived onsite at 9:45 and equipment was being staged upon my arrival. Sound barriers were placed on both sides of the drilling area against the subject property residence and the neighboring residence (see photo 2). The location of MW-13D is the side yard of the residence. Plastic mats were placed in a pathway from the street to the drilling location to prevent the drill rig from driving over grass. The mats were also staged in the drilling area and areas of highly traveled grass. Stantec was onsite performing air monitoring with summa canisters (photo 4) at locations around the drilling area. Personnel from SPLP was performing noise monitoring with a handheld device.

Drilling began at 10:35. The borehole was advanced to 32 feet below ground surface (bgs) before stopping for 20 minutes to allow for groundwater recharge. There was a soft zone at 30 feet bgs so the driller advanced two more feet to avoid collapse. Drilling started again at 11:40. Drilling was finished at 12:30 and the total depth of the borehole was 75 feet bgs. During drilling soil was collected from five-foot intervals and placed on poly sheet for screening and characterization (photo 3).

The well was constructed with 25 feet of screen. There were PID readings of 0.7 ppm and 1.2 ppm at 38 and 49 feet, respectively. The geologist from GES noted to me that the empty drum used for soil collection and disposal had a PID reading of 15 ppm when it was empty with no contents inside. This is likely due to the cleaning solvent used.

I departed the site when drilling was completed at 13:45.

DEP Representative Name Olivia Budnovitch		DEP Representative Signature Olivia Budnovitch <small>Digitally signed by Olivia Budnovitch Date: 2025.09.17 10:05:47 -0400</small>		Title Geoscientist		Date: 9/15/25	
						Telephone: 484.250.5705	
Signature by the person interviewed does not necessarily imply concurrence with the findings on this report, but does acknowledge that the person was shown the report or that a copy was left with the person.							
Interviewee Name		Interviewee Signature		Title		Date:	
						Telephone:	

Facility Name: Glenwood Drive & Walker Road

Primary Facility ID: 881609

MAPS / PHOTOGRAPHS / ATTACHMENTS

Map 1: Google Maps location of Washington Crossing neighborhood



DEP Representative Name Olivia Budnovitch	DEP Representative Signature Olivia Budnovitch <div>Digitally signed by Olivia Budnovitch Date: 2025.09.17 10:06:05 -04'00'</div>	Title Geoscientist	Date: 9/15/25
			Telephone:484.250.5705
Signature by the person interviewed does not necessarily imply concurrence with the findings on this report, but does acknowledge that the person was shown the report or that a copy was left with the person.			
Interviewee Name	Interviewee Signature	Title	Date:
			Telephone:



## NARRATIVE REPORT FORM

Facility Name: Glenwood Drive & Walker Road

Primary Facility ID: 881609

Photo 1: Drill rig and mat setup




Photo 2: Sound barrier set up




Photo 3: Soil characterization



Photo 4: Summa Canister

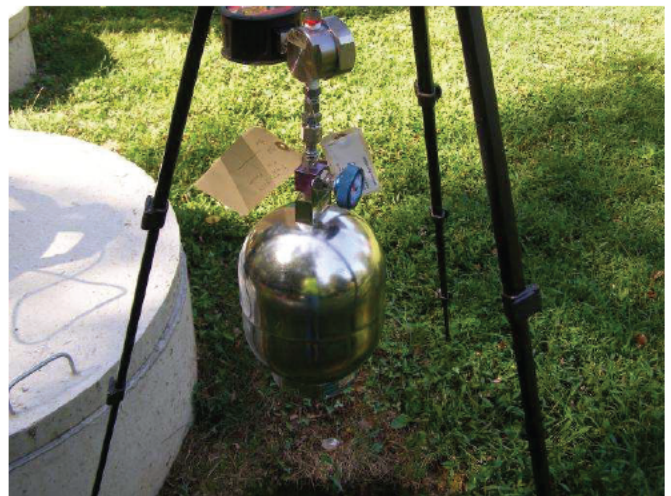

<b>DEP Representative Name</b> Olivia Budnovitch	<b>DEP Representative Signature</b>  <small>Digitally signed by Olivia Budnovitch Date: 2025.09.17 10:06:25 -0400</small>	<b>Title</b> Geoscientist	<b>Date:</b> 9/15/25 <b>Telephone:</b> 484.250.5705
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report, but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
<b>Interviewee Name</b>	<b>Interviewee Signature</b>	<b>Title</b>	<b>Date:</b> <b>Telephone:</b>