



NARRATIVE REPORT FORM

Facility Name: Glenwood Drive and Walker Road
Primary Facility ID: 881609

Inspection Date: 10/6/25		Inspection Time: 9:00		Lat/Long:	
Program: ECB		☐ Storage Tanks		☐ HSCA	
				☒ LRP	
Owner Name: Energy Transfer			Inspection ID:		Site ID:
Facility Location (911) Address: Glenwood Drive, Walker Road, and Spencer Road Washington Crossing, PA 18977				Municipality: Upper Makefield Twp.	
				County: Bucks	
Responsible Official Name: Brad Fish Title: Senior Environmental Specialist Emergency Response & Remediation				Responsible Official Address: 100 Green Street Marcus Hook, PA 19061	
Responsible Official Telephone: 610-859-6297 Email Address: bradford.fish@energytransfer.com				Interviewee Name: Affiliation: Email Address:	

Narrative:

Olivia Budnovitch visited the site to oversee the morning measuring and gauging event that is performed on the pre-determined residential potable wells and recovery well RW-2. The GES crew was onsite setting up equipment at [REDACTED] upon my arrival. The following table details the data collected during site activities.

Address	Arrival Time	PID (ppm)	DTP (ft.)	DPW (ft.)	LNAPL thickness (ft.)
[REDACTED] – before bailing	9:20	314.4	31.79	31.8	0.01
[REDACTED] – after bailing	-	-	-	32.20	0
[REDACTED]	9:30	5.9	-	30.15	0
[REDACTED]	9:42	125.4	-	29.89	0
[REDACTED]	9:30	0.0	-	55.68	0
[REDACTED]	9:25	1.3	-	55.26	0

DTP – Depth to product (LNAPL)

DPW – Depth to water

There was a second GES crew meeting at [REDACTED] who collected the data at [REDACTED] & [REDACTED]. I did not observe the collection of this data, but the crew shared it with me.

DEP Representative Name Olivia Budnovitch	DEP Representative Signature Olivia Budnovitch Digitally signed by Olivia Budnovitch Date: 2025.10.10 14:24:03 -0400	Title Geoscientist	Date: 10/10/25
			Telephone: 484-250-5705
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date:
			Telephone:

Facility Name: Glenwood Drive and Walker Road

Primary Facility ID: 881609

Narrative (continued):

Observations:

- The interface probe was properly decontaminated between each use.
- PID readings were obtained immediately when the well cap was opened.
- Product samples were collected from the recovery well RW-2 (photo 2).
- There was a RETTEW truck parked at [REDACTED] with a water level meter sitting in the newly installed potable well.
-

Recovery well RW-2:

The well was opened at 9:51. The following data was collected:

- PID reading: 275.0 ppm
- Depth to product: 27.19 feet
- Depth to water: 27.29 feet
- Product thickness: 0.10 feet

When the passive skimmer system was pulled from the well the containment chamber was 100% filled with product (photo 1). GES collected product samples and emptied the product into a bucket for later disposal. They followed with routine pumping of the recovery well.

I departed the neighborhood at 10:15.

DEP Representative Name Olivia Budnovitch	DEP Representative Signature Olivia Budnovitch Digitally signed by Olivia Budnovitch Date: 2025.10.10 14:24:32 -0400	Title Geoscientist	Date: 10/10/25 Telephone: 484-250-5705
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date: Telephone:

NARRATIVE REPORT FORM

Facility Name: Glenwood Drive and Walker Road
Primary Facility ID: 881609

MAPS / PHOTOGRAPHS / ATTACHMENTS

Map: Google Earth view of Washington Crossing neighborhood

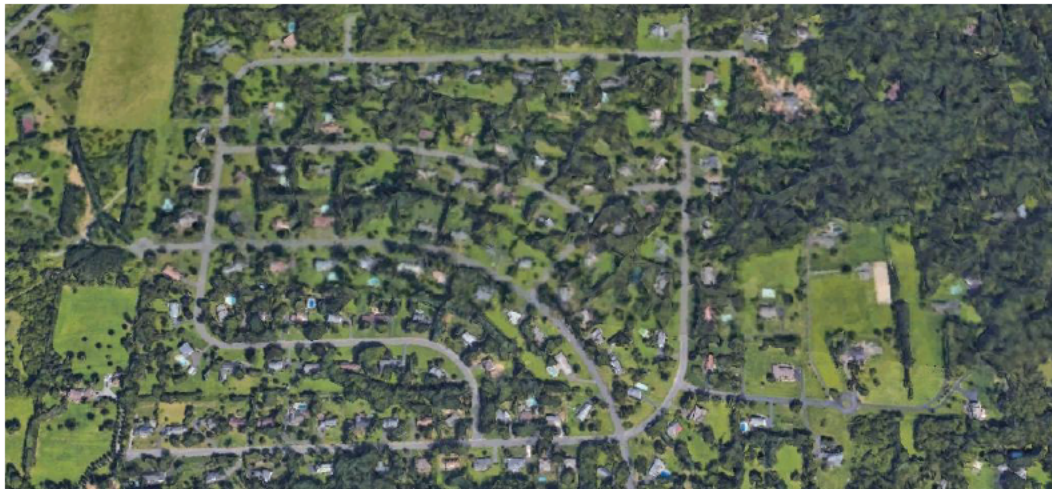


Photo 1: Skimmer from RW-2



Photo 2: Product samples collected from RW-2



DEP Representative Name Olivia Budnovitch	DEP Representative Signature Olivia Budnovitch Digitally signed by Olivia Budnovitch Date: 2025.10.10 14:25:03 -0400	Title Geoscientist	Date: 10/10/25 Telephone: 484-250-5705
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date: Telephone: