

**NARRATIVE REPORT FORM**
Facility Name: Glenwood Drive and Walker Road

Primary Facility ID: 881609 \_\_\_\_\_

Inspection Date: 9-10-25	Inspection Time: 9:10	Lat/Long:										
Program: ECB	<input type="checkbox"/> Storage Tanks	<input type="checkbox"/> HSCA	<input checked="" type="checkbox"/> LRP									
Owner Name: Energy Transfer		Inspection ID:	Site ID:									
<b>Facility Location (911) Address:</b> Glenwood Drive and Walker Road Washington Crossing, PA 18977		<b>Municipality:</b> Upper Makefield Twp. <b>County:</b> Bucks										
<b>Responsible Official Name:</b> Brad Fish  <b>Title:</b> Senior Environmental Specialist Emergency Response & Remediation		<b>Responsible Official Address:</b> 100 Green Street Marcus Hook, PA 19061										
<b>Responsible Official Telephone:</b> 610-859-6297 <b>Email Address:</b> bradford.fish@energytransfer.com												
<b>Entities Present:</b> DEP – Rebecca Flannery GES – Mike Haezebrouck and Ariana Miranda(drilling) ET – Chris Embry, Elijia Contreas, Bill Barth, Ryan Dipper, and Nany Sadlon Stantec - Air and Sound Monitoring												
<b>Purpose:</b> Oversight of monitoring well MW-12D installation at [REDACTED]												
<b>Weather:</b> Cloudy; 63°F												
<b>Narrative:</b> <p>I arrived at 9:10 am at [REDACTED] to observe the installation of monitoring well MW-12D. This well is located on the property closest to Spencer Road.</p>												
<b>Well Installation:</b> <ul style="list-style-type: none"> <li>- Both locations for the monitoring wells, MW-12S and MW-12D were hand cleared.</li> <li>- Refusal was encountered at both well locations at a depth of 3.5-feet bgs.</li> <li>- In the soil sample collected from the hand clearing in MW-12S there was a PID reading of 0.2ppm.</li> <li>- There were no noted PID readings down to a depth of 30-feet bgs.</li> <li>- No water entered the well boring after sitting for about an hour when the drilling was paused at 30-feet bgs.</li> <li>- Competent bedrock was encountered at a depth between 15-20-feet bgs.</li> <li>- The soil/rock was moist between 35-40-feet bgs.</li> <li>- Groundwater was encountered at a depth of 10-feet bgs.</li> <li>- Coal shale was noticed in the drill cuttings/water at the depths of 55, 71-73, and 67-feet bgs.</li> </ul>												
<table border="1"> <thead> <tr> <th>Start Time</th> <th>End Time</th> <th>Depth (ft.)</th> </tr> </thead> <tbody> <tr> <td>11:16</td> <td>11:42</td> <td>35</td> </tr> <tr> <td>12:37</td> <td>13:30</td> <td>75</td> </tr> </tbody> </table>				Start Time	End Time	Depth (ft.)	11:16	11:42	35	12:37	13:30	75
Start Time	End Time	Depth (ft.)										
11:16	11:42	35										
12:37	13:30	75										

DEP Representative Name Rebecca Flannery	DEP Representative Signature Digital signature by Rebecca Flannery Rebecca Flannery Date: 2025.09.17 07:03:10-0400	Title Geoscientist	Date: 9-16-25 Telephone: 484-250-5779
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date: Telephone:

## NARRATIVE REPORT FORM

Facility Name: Glenwood Drive and Walker Road

Primary Facility ID: 881609 \_\_\_\_\_

**Narrative (continued):**Notes:

- The resident informed ET that there was once a hand dug well on the property, but it was filled in about a year ago and is not in use.
- The resident from [REDACTED] came and observed some of the monitoring well being drilled.
- Chris from ET informed me that Monday September 15, 2025, that the drill rig will be set up and will start installing the potable well at [REDACTED].
- Mike from GES informed me that transducers were being installed in the recently installed monitoring wells.
- The following addresses were gauged pre and post drilling activities: [REDACTED], [REDACTED], [REDACTED], [REDACTED] and [REDACTED]. Permission was not given from [REDACTED]. I was informed by Ariana that the water level dropped in the potable well 10-feet from pre to post measurement.

Conversation with resident at [REDACTED]

- I spoke with the resident ([REDACTED]) at [REDACTED] while the well was being installed. I explained what was happening and asked if [REDACTED] had any questions. [REDACTED] did not at the time, I let [REDACTED] know that I'd be around until the drilling was complete if [REDACTED] thought of any. I did notice [REDACTED] taking some photos during the drilling.
- [REDACTED] stated that [REDACTED] would like any field narratives from the days that the wells were drilled on [REDACTED] property. I told [REDACTED] I would send [REDACTED] the redacted copies once I got them back from my attorney.

I departed the site at 13:47



DEP Representative Name Rebecca Flannery	DEP Representative Signature Rebecca Flannery <small>Digitally signed by Rebecca Flannery Date: 2025-09-17 07:03:26-0400</small>	Title Geoscientist	Date: 9-16-25 Telephone: 484-250-5779
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date: Telephone:

## NARRATIVE REPORT FORM

Facility Name: Glenwood Drive and Walker Road

Primary Facility ID: 881609

### MAPS / PHOTOGRAPHS / ATTACHMENTS

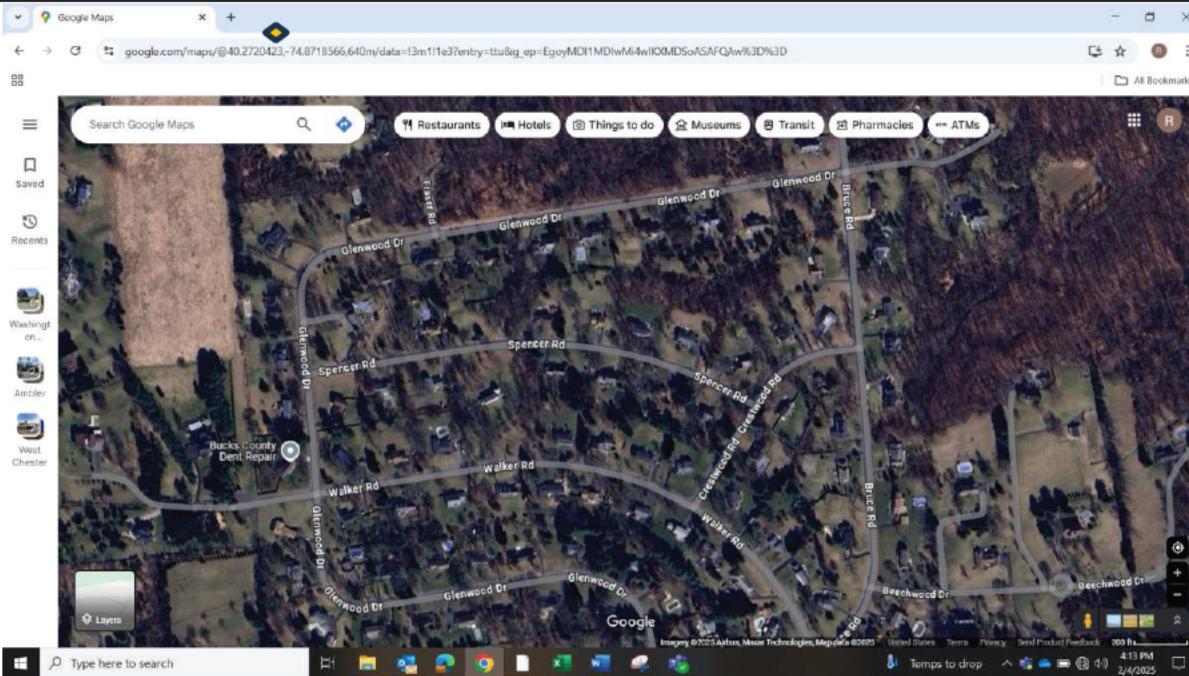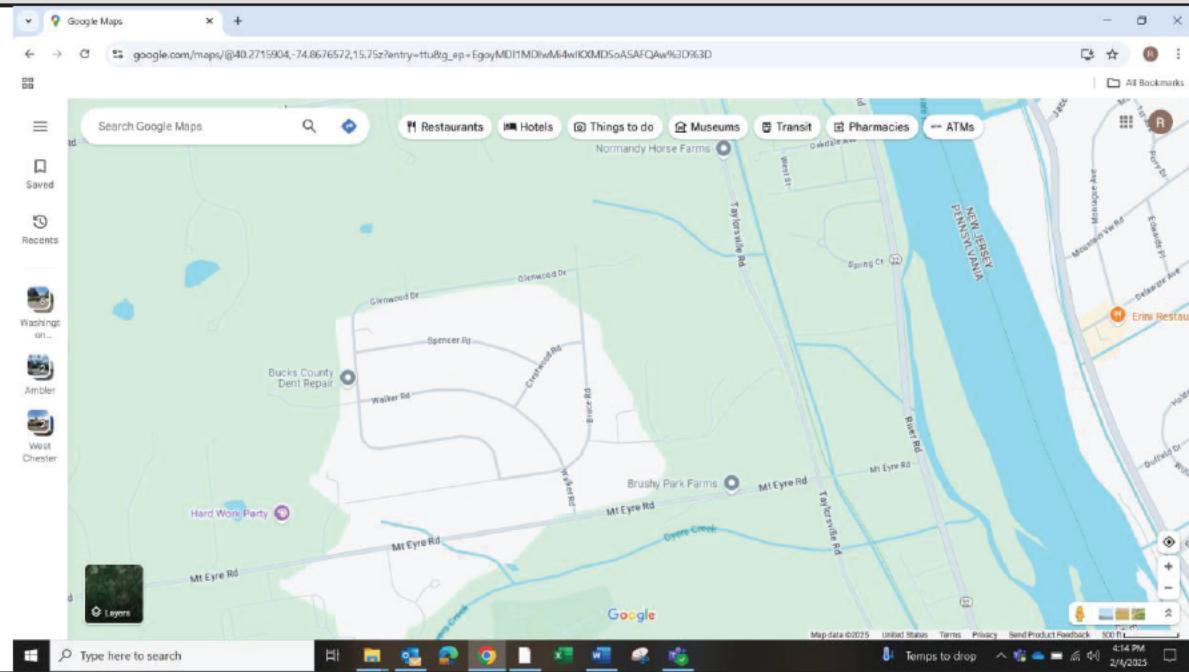

DEP Representative Name Rebecca Flannery	DEP Representative Signature Rebecca Flannery <small>Digitally signed by Rebecca Flannery Date: 2025-09-17 07:03:40 -04'00'</small>	Title Geoscientist	Date: 9-16-25 Telephone: 484-250-5779
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date: Telephone:

**NARRATIVE REPORT FORM**

 Facility Name: Glenwood Drive and Walker Road Primary Facility ID: 881609

 Sound barriers set up at [REDACTED]  
 9-10-25


Sound barriers set up at [REDACTED]

9-10-25


 Drill rig set up at [REDACTED]  
 9-10-25

 The first appearance of the presence of coa' s' ale  
 9-10-25

DEP Representative Name Rebecca Flannery	DEP Representative Signature Rebecca Flannery <small>Digitally signed by Rebecca Flannery Date: 2025.09.17 07:03:53-0400</small>	Title Geoscientist	Date: 9-16-25 Telephone: 484-250-5779
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date:

## NARRATIVE REPORT FORM

Facility Name: Glenwood Drive and Walker RoadPrimary Facility ID: 881609

Coal shale (dark liquid) floating on water from MW-11D  
 9-10-25

**Intentionally Left Blank**



75 feet ← 40 feet  
 35 feet ← 5 feet  
 Soil samples from every 5 feet while installing MW-11S  
 9-10-25

**Intentionally Left Blank**

DEP Representative Name Rebecca Flannery	DEP Representative Signature Rebecca Flannery <small>Digitally signed by Rebecca Flannery Date: 2025-09-17 07:54:07 -04'00'</small>	Title Geoscientist	Date: 9-16-25 Telephone: 484-250-5779
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date: