

NARRATIVE REPORT FORM
Facility Name: Glenwood Drive and Walker Road

Primary Facility ID: 881609 _____

Inspection Date: 10-20-25	Inspection Time: 8:55	Lat/Long:																																																																					
Program: ECB	<input type="checkbox"/> Storage Tanks	<input type="checkbox"/> HSCA	<input checked="" type="checkbox"/> LRP																																																																				
Owner Name: Energy Transfer		Inspection ID:	Site ID:																																																																				
Facility Location (911) Address: Glenwood Drive and Walker Road Washington Crossing, PA 18977		Municipality: Upper Makefield Twp.																																																																					
		County: Bucks																																																																					
Responsible Official Name: Brad Fish		Responsible Official Address: 100 Green Street Marcus Hook, PA 19061																																																																					
Title: Senior Environmental Specialist Emergency Response & Remediation																																																																							
Responsible Official Telephone: 610-859-6297 Email Address: bradford.fish@energytransfer.com																																																																							
Entities Present: DEP – Rebecca Flannery GES – Devin Graham, Andy Wallet, and Mike Haezebrouck ET – Nancy Sadlon																																																																							
Purpose: Oversight of Weekly gauging of potable wells and recovery wells on Glenwood Drive																																																																							
Weather: Cloudy, windy, 60's																																																																							
Narrative: <u>Gauging data:</u>																																																																							
<table border="1"> <thead> <tr> <th><u>Address</u></th> <th><u>Time</u></th> <th><u>PID (ppm)</u></th> <th><u>DTP (ft.)</u></th> <th><u>DPW (ft.)</u></th> <th><u>LNAPL thickness (ft.)</u></th> </tr> </thead> <tbody> <tr><td>(pre bail)</td><td>9:09</td><td>130.1</td><td>29.41</td><td>29.42</td><td>0.01</td></tr> <tr><td>(post bail)</td><td>9:16</td><td></td><td>-</td><td>29.64</td><td>-</td></tr> <tr><td></td><td>9:22</td><td>4.2</td><td>-</td><td>29.25</td><td>0.0</td></tr> <tr><td></td><td>9:28</td><td>62.7</td><td>-</td><td>29.85</td><td>0.0</td></tr> <tr><td></td><td>9:39</td><td>0.0</td><td>-</td><td>58.31</td><td>0.0</td></tr> <tr><td></td><td>9:35</td><td>2.3</td><td>-</td><td>55.96</td><td>0.0</td></tr> <tr><td>RW-2 (Glenwood Drive) w/skimmer</td><td>9:52</td><td>361.9</td><td>47.43</td><td>47.46</td><td>0.03</td></tr> <tr><td>RW-2 (Glenwood Drive) w/o skimmer</td><td>9:58</td><td>-</td><td>27.39</td><td>27.62</td><td>0.23</td></tr> <tr><td>RW-3 (Glenwood Drive) w/skimmer</td><td>10:03</td><td>288.7</td><td>-</td><td>26.98</td><td>0.0</td></tr> <tr><td>RW-3 (Glenwood Drive) w/o skimmer</td><td>10:06</td><td>-</td><td>-</td><td>27.90</td><td>-</td></tr> </tbody> </table>						<u>Address</u>	<u>Time</u>	<u>PID (ppm)</u>	<u>DTP (ft.)</u>	<u>DPW (ft.)</u>	<u>LNAPL thickness (ft.)</u>	(pre bail)	9:09	130.1	29.41	29.42	0.01	(post bail)	9:16		-	29.64	-		9:22	4.2	-	29.25	0.0		9:28	62.7	-	29.85	0.0		9:39	0.0	-	58.31	0.0		9:35	2.3	-	55.96	0.0	RW-2 (Glenwood Drive) w/skimmer	9:52	361.9	47.43	47.46	0.03	RW-2 (Glenwood Drive) w/o skimmer	9:58	-	27.39	27.62	0.23	RW-3 (Glenwood Drive) w/skimmer	10:03	288.7	-	26.98	0.0	RW-3 (Glenwood Drive) w/o skimmer	10:06	-	-	27.90	-
<u>Address</u>	<u>Time</u>	<u>PID (ppm)</u>	<u>DTP (ft.)</u>	<u>DPW (ft.)</u>	<u>LNAPL thickness (ft.)</u>																																																																		
(pre bail)	9:09	130.1	29.41	29.42	0.01																																																																		
(post bail)	9:16		-	29.64	-																																																																		
	9:22	4.2	-	29.25	0.0																																																																		
	9:28	62.7	-	29.85	0.0																																																																		
	9:39	0.0	-	58.31	0.0																																																																		
	9:35	2.3	-	55.96	0.0																																																																		
RW-2 (Glenwood Drive) w/skimmer	9:52	361.9	47.43	47.46	0.03																																																																		
RW-2 (Glenwood Drive) w/o skimmer	9:58	-	27.39	27.62	0.23																																																																		
RW-3 (Glenwood Drive) w/skimmer	10:03	288.7	-	26.98	0.0																																																																		
RW-3 (Glenwood Drive) w/o skimmer	10:06	-	-	27.90	-																																																																		
DTP – Depth to product (LNAPL)																																																																							
DPW – Depth to water																																																																							

DEP Representative Name Rebecca Flannery	DEP Representative Signature Rebecca Flannery <small>Digital signature by Rebecca Flannery Date: 2025-10-21 08:58:11-04:00</small>	Title Geoscientist	Date: 10-21-25
Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.			
Interviewee Name	Interviewee Signature	Title	Date:
			Telephone:

NARRATIVE REPORT FORM

Facility Name: Glenwood Drive and Walker Road

Primary Facility ID: 881609 _____

Narrative (continued):

Information from GES:

- Gauging team has been asked to measure any recoverable LNAPL in a plastic graduated cylinder that holds 4,000mL.
- Recovery wells RW-2 and RW-3 were the only recovery wells to be gauged.
- Recovery well RW-1, RW-4, and the potable well on [REDACTED] were not gauged due to the transducers which were installed in them.

Observations:

[REDACTED]:

- There was a detectable amount of LNAPL gauged, the well was bailed and placed in the graduated cylinder to measure the LNAPL, which was approximately 5mL.
- No LNAPL sample was able to be collected to sample.

[REDACTED]:

- The resident observed the gauging of their potable well.

Recovery well RW-2:

- Depth to LNAPL/water was gauged before and after the skimmer was removed.
- A LNAPL sample was collected at 9:56 to be analyzed.
- There was 1,750mL of LNAPL which was measured to be from the skimmer.
- All water and LNAPL was placed in a designated metal bucket to be disposed of later.

Recovery Well RW-3:

- Depth to LNAPL/water was gauged before and after the skimmer was removed.
- A LNAPL sample was collected at 10:06 to be analyzed.
- There was 115mL of LNAPL which was measured to be from the skimmer.
- All water and LNAPL was placed in a designated metal bucket to be disposed of later.

I went to the ET trailer to talk to Nancy Sadlon of ET if she was present.

She was and let me know that the excavation near the pipeline had a new tentative schedule date of October 28, 2025 so that it would correspond with the pause in pumping product in the pipe.

I departed the site at 10:35.



DEP Representative Name Rebecca Flannery	DEP Representative Signature Digitally signed by Rebecca Flannery Rebecca Flannery Date: 2025.10.21 08:58:27 -04'00'	Title Geoscientist	Date: 10-21-25 Telephone: 484-250-5779
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date: Telephone:

NARRATIVE REPORT FORM

Facility Name: Glenwood Drive and Walker Road

Primary Facility ID: 881609

MAPS / PHOTOGRAPHS / ATTACHMENTS

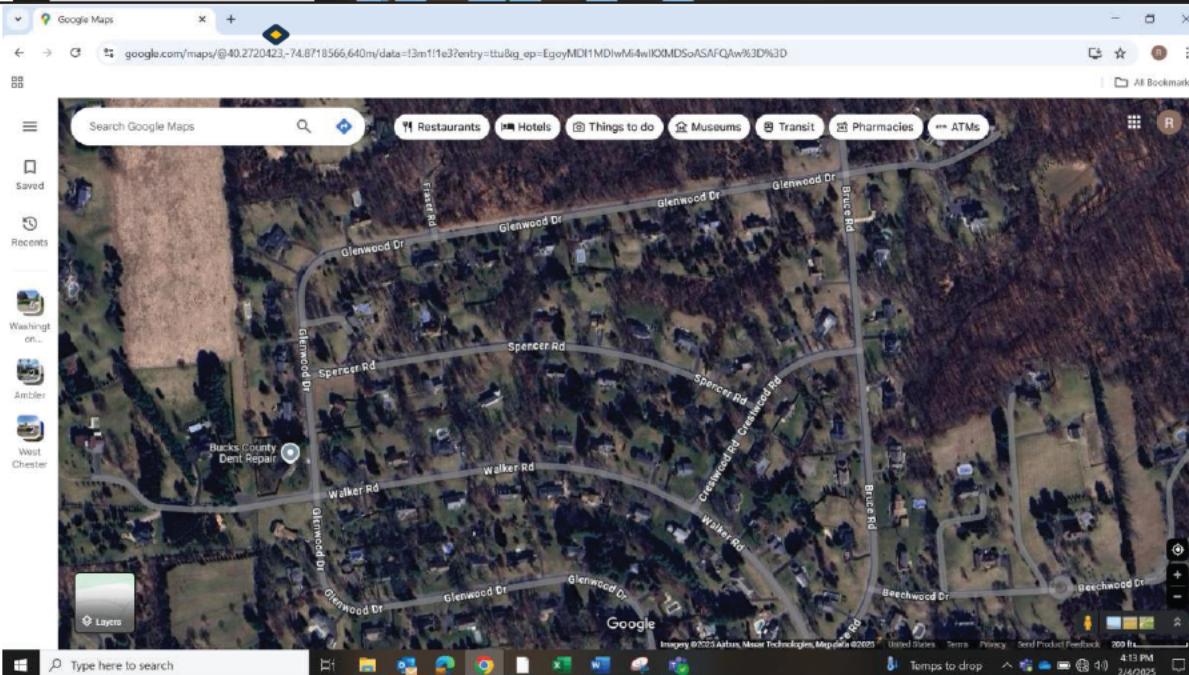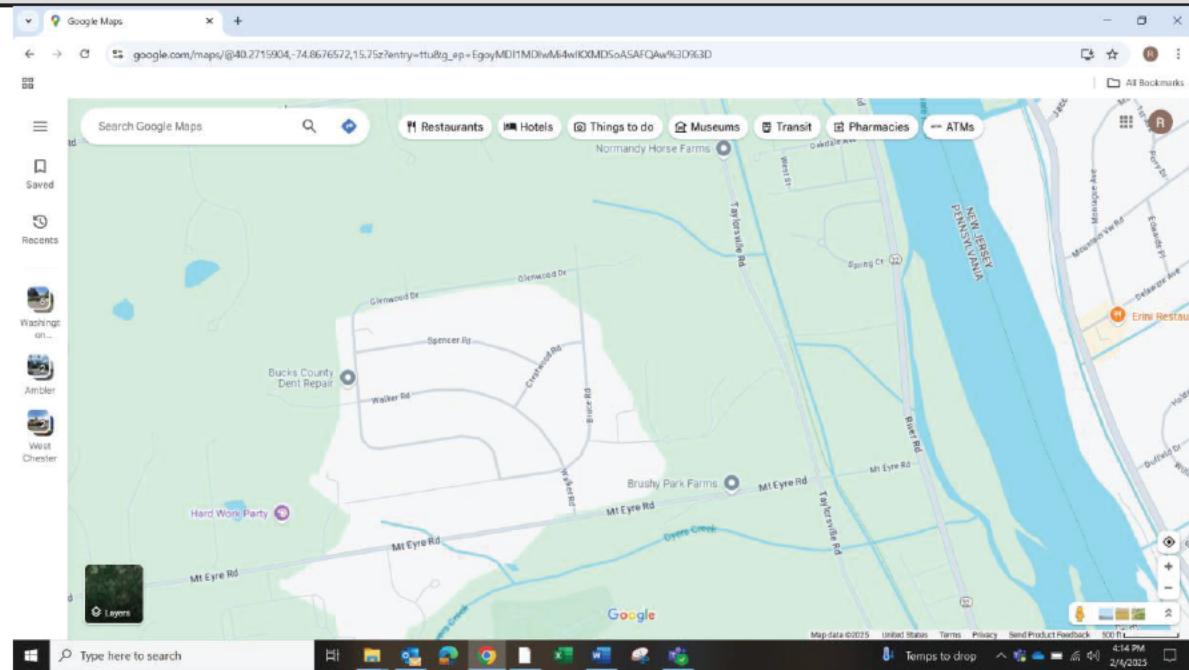

DEP Representative Name Rebecca Flannery	DEP Representative Signature Rebecca Flannery <small>Flannery Date: 2023.10.21 08:58:41 -04:00</small>	Title Geoscientist	Date: 10-21-25 Telephone: 484-250-5779
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date: Telephone:

NARRATIVE REPORT FORM
Facility Name: Glenwood Drive and Walker RoadPrimary Facility ID: 881609
 Bailed water from former potable well on [REDACTED]
 10-20-25 @ 9:13

 Minimal LNAPL from former potable well at [REDACTED]
 10-20-25 @ 9:14

 Skimmer removed from recovery well RW-2 on Glenwood Drive
 10-20-25 @ 9:52

 Amount of LNAPL recovered from RW-2 (1,750 mL)
 10-20-25 @ 9:55

DEP Representative Name Rebecca Flannery	DEP Representative Signature Rebecca Flannery <small>Digitally signed by Rebecca Flannery Date: 2025.10.21 08:58:55-04'00'</small>	Title Geoscientist	Date: 10-21-25 Telephone: 484-250-5779
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date:

NARRATIVE REPORT FORM

 Facility Name: Glenwood Drive and Walker Road Primary Facility ID: 881609


Skimmer removed from recovery well RW-3 on Glenwood Drive
 10-20-25 @ 10:02



Amount of LNAPL recovered from RW-3 (100 mL)
 10-20-25 @ 10:06

Intentionally Left Blank

Intentionally Left Blank

DEP Representative Name Rebecca Flannery	DEP Representative Signature Digitally signed by Rebecca Flannery Date: 2025-10-21 08:59:08-04'00'	Title Geoscientist	Date: 10-21-25 Telephone: 484-250-5779
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date: